कार्यालयः अधीक्षण अभियन्ता,एम-42

लोक निर्माण विभाग, (रा.रा.क्षेत्र दिल्ली सरकार) सुखदेव विहार, मथुरा रोड, नई दिल्ली—110025 दूरभााष/फैक्स संख्या : 26322484/26837368



O/o THE SUPERINTENDING ENGINEER, M-42

PWD, (Govt of N.C.T. of Delhi)
Sukhdev Vihar, Mathura Road, New Delhi-110025.

Telephone/Fax No: 26322484/26837368

No. 61(1)/CBMC M-42/PWD/2014-15/141

Dated 30.04.2014

INSPECTION NOTE

The school building at S.K.V. Noor Nagar was inspected by the undersigned on 29.04.2014 alongwith Sh Vinod Kumar, Executive Engineer, CBMD M-423, Assistant Engineer, M-4232 & Concerned contractor. The following observations have been made.

Name of Work:

Up gradation works (Urdu School) at S.K.V. Noor

Nagar, New Delhi.

Agreement No.:

32/EE/CBMD M-423/2013-14

Agency:

Sh. Rakesh Kumar

Tendered Amount:

Rs.67,15,230/-

- 1. It was intimated by EE that main part/major works of up gradation work as per agreement have been completed in this school.
- 2. Moulding of edges of granite stone at main entrance staircase is required to be done. At few locations, the joints of granite stone are not properly filled up with pigment. 3-4 slabs were found to be short, not of matching shade are to be replaced.
- 3. At first floor columns of main building, border of black/dark brown colour granite stone is required to be done for aesthetic reasons, to match the line & level of the small strips at the junction of column with beam(s).
- 4. At few locations, minor repair of plaster, filling putty in holes, distempering & painting in corridors are required to be redone, to get the smooth surface.
- 5. Sheet at expansion joints of building is required to hide the wide gaps.
- 6. Minor repair works in toilets are required to be done.
- 7. Skirting at few locations in the corridors of missing/broken Kota stone at 2^{nd} floor is required to be fixed.
- 8. Repair of dilapidated RCC vertical fins, beams & chajjas etc are required (may be separately if not part of this agreement).
- 9. Cleaning & finishing of glass mosaic tiles are required after repairing, fixing tiles in line and level especially near staircase.
- 10. Buffering/Grinding of granite stone at edges of the platform at prayer ground is required, to avoid slippery surface.
- 11. Edges of granite stones at pillars required to be grinded/polished.

- 12. Granite lining of boundary wall of play ground is not done properly at number of locations is required to be replaced with proper size and workmanship.
- 13. De-concretisation of about 1.0 m all-around the trees (2 trees near main gate, 1 at platform etc) are required.

Executive Engineer is directed to inspect the work intensively, take immediate necessary action to **get the defects rectified** and balance works completed in next 2-3 weeks time i.e. before opening of schools.

(S.K. Agarwal)
Engineer (M. 42)

Superintending Engineer (M-42)

Copy to:

The Chief Engineer, PWD, M-4, New Delhi for information please.

The Executive Engineer, PWD, M-423, New Delhi for immediate necessary action and submission of the compliance report.

Superintending Engineer (M-42)