 




राष्ट्रीय राजधानी क्षेत्र दिल्ली सरकार
GOVT. OF NATIONAL CAPITAL TERRITORY OF DELHI
लोक निर्माण विभाग
PUBLIC WORKS DEPARTMENT



मुख्य अभियंता(पूर्व)/अनु
लोक निर्माण विभाग,
दिल्ली सरकार, तृतीय तल,
एम. एस. ओ. भवन, आई. पी. एस्टेट,
नई दिल्ली-110002.

CHIEF ENGINEER(EAST)/M
PUBLIC WORKS DEPARTMENT
GNCTD, 3RD FLOOR, MSO BUILDING,
I.P. ESTATE, NEW DELHI – 110002.
Phone : 011-23319715 Fax : 011-23329880
E-Mail : cepwddelhimzm2@gmail.com

संख्या 20(5)/PWD/CE East/M/2016/41-E

दिनांक 09.02.2016

INSPECTION NOTE


Sub: **Inspection Note of Chief Engineer (East)-M on dated 6/2/2016**

The road of North-East District were inspected by the CE(East)-M in the presence of Shri K.P. Singh, EE(C)/Bldg (North-East), Shri Pawan Aggarwal, AE, Shri Sudhir Kumar, AE & Shri Jai Shankar Prasad, JE. The following observations are made:-

- (i) One estimate of “strengthening of Service Road of RBS Centre to Metro Canteen Building alongwith C/o RCC Box Drain” has been prepared and submitted to Competent Authority for approval. The Executive Engineer intimated that since lot of heavy vehicles ply on this road so strengthening of the road is necessary for which Benkelmann beam test has already been got done. SE(North-East) to go through this estimate and submit to CE(East)-M for accord of A/A & E/S. Any modification, if desired may also be made.
- (ii) There was lot of garbage found on MB Road towards Yamuna side. AE expressed his inability to clear it during day time due to strike of MCD workers and their resistance thereof. He assured that this should be cleared during night time. EE to check the compliance and report.
- (iii) The “Road Restoration of Service Road cut by DMRC from Loni Gole Chakkar to Bhopra Border of Southern side of Wazirabad Road (Road No.63)” was inspected. The WBM

layers laid down were not compacted properly and lot of loose materials was coming out throughout the stretch. Even the gradation of stone aggregate used for WBM work was not as per contracted specification. EE to check the complete stretch and get dismantled the sub-standard work carried out and re-do the same with proper specification. No bituminous work should be carried out before ensuring the WBM Work is done properly as per contracted specification.

- (iv) “Widening of Bank Colony Road and remodeling of drain and footpath from adjoining MCD Road of Road No.63 to Harsh Vihar (Western site of Mandoli Jail Complex)” was inspected and it was found that the quality of concrete work being carried out is not upto the mark at places. The quality of Concrete was found poor and proper lines & levels were also not maintained. Even the spacing of reinforcement bars was not as per the requirement at some places. The length of SW drain constructed with sub-standard specification be got dismantled and re-done. Further, there was lot of excavated earth lying all along the drain under construction should also be removed leaving the quantity of earth required for back filling. EE should ensure that the release of payment to the agency is done only after ensuring that the work has been done as per specification.

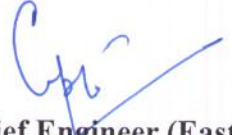
Chief Engineer (East)-M

Copy to:-

1. OSD(PWD) to Hon'ble Minister, Govt. of Delhi, A-Wing, th Level, Delhi Secretariate, IP Estate, New Dellhi.
2. The Pr. Chief Engineer (PWD)/M, 12th Floor, MSO Building, New Delhi.
3. The Superintending Engineer (North-East), PWD/M, 2nd Nizamudding, New Delhi.
4. The Executive Engineer (North-East)Building, PWD, Shastri Park, Delhi.