



राष्ट्रीय राजधानी क्षेत्र दिल्ली सरकार
GOVT. OF NATIONAL CAPITAL TERRITORY OF DELHI
लोक निर्माण विभाग, PUBLIC WORKS DEPARTMENT

कार्यालय अधीक्षण अभियन्ता (नार्थ),
अनुरक्षण परिमंडल, लो0नि0वि0,
पश्चिमी यमुना तटबंध रिंग रोड सामने,
अन्तराज्यीय बस अड्डा कश्मीरी गेट दिल्ली-110006
दूरभाष : 011-23865967 / 23865966 फ़ैक्स : 23865968
ईमेल:- sepwddelhim32@gmail.com

O/o the SUPERINTENDING ENGINEER (North),
Maintenance Circle,
PUBLIC WORKS DEPARTMENT,
Western Yamuna Bank, Ring Road,
Opp.ISBT Kashmere Gate, DELHI-110 006.
Phone: 011-23865967@23865966
Email:- sepwddelhim32@gmail.com

संख्या: 21(1423)/अनु0परि0(नार्थ)/लो.नि.वि./2017-18/2606
सेवा में,

दिनांक: 11-08-2017

- | | |
|--|--|
| <p>1. कार्यपालक अभियन्ता,
उत्तर भवन मंडल, लोक निर्माण विभाग
अन्तराज्यीय बस अड्डा कश्मीरी गेट
दिल्ली-110006</p> | <p>2. कार्यपालक अभियन्ता,
उत्तर सड़क मंडल, लोक निर्माण विभाग
नजदीक खालसा कालेज
दिल्ली-110054</p> |
| <p>3. उपनिदेशक (उद्यान)
उद्यान मंडल, लोक निर्माण विभाग
एम0एस0ओ0भवन, 13वां तल,
नई दिल्ली-110002</p> | <p>4. कार्यपालक अभियन्ता (वै.)
उत्तर वैद्युत मंडल, लोक निर्माण विभाग
रोहिणी, दिल्ली</p> |

विषय: दिनांक 09-08-2017 एवं 10-08-2017 को स्कूलों के निरीक्षण रिपोर्ट के संबंध में ।

अधोहस्ताक्षरी द्वारा कार्यपालक अभियन्ता,(भवन) उत्तर, सहायक अभियन्ता, उपमंडल,एन0बी-11, कनिष्ठ अभियन्ता एवं ठेकेदार के प्रतिनिधि की उपस्थिति में सर्वोदय विधालय , चांदपुर माजरा, दिल्ली, वैद पंडित खुशीराम सर्वोदय बाल विधालय, नांगल ठाकरान एवं उपदेश कौर सर्वोदय कन्या विधालय, दरियापुर कलां का निरीक्षण किया गया । निरीक्षण के दौरान पाई गई त्रुटियों का विवरण निम्न प्रकार से है:-

दिनांक: 09-08-2017

सिविल एवं वैद्युत कार्य:-

क. सर्वोदय विधालय , चांदपुर माजरा, दिल्ली

1. Enamel paint and plaster not done smoothly in ladies toilet at Ground floor.
2. Exhaust fan is making noise (ACTION:EE,Elect.)
3. Electric board has not fixed properly with screws. (ACTION:EE,Elect.)
4. Cement plaster not finished in the back side of the ladies toilet door.
5. Electric board not fixed properly with screws in room near ladies toilet.(ACTION:EE,Elect.)
6. Scrapping has not been done properly on ceiling in corridor in front of ladies toilet at ground floor.
7. Scrapping has not been done properly on ceiling in corridor in front of Principal Office at ground floor.
8. Distempering has not been completed on inner side of almirah in corridor at ground floor.
9. Electric junction boxes have not been covered at many places.
10. Enamel paint finishing done without scrapping at most of the places in corridors. Same may be redone after scrapping.
11. Surface not finished with cement putty before applying distemper on wall surface near staircase.
12. Scrapping in corridor has not been done properly. Hence may be redone.

Contd.....2/-

13. Splashes not removed from wall tile in store at First floor.
14. Splashes not removed from switch board.
15. Finishing of ventilator not done properly with enamel paint.
16. Proper scrapping not done in the wall of mumty. Distempering may be redone after scrapping.
17. Some Electric Board found in dead condition in the mumty. **(ACTION: EE, Elect.)**
18. MCB Box found without cover at some places. **(ACTION: EE, Elect.)**
19. MS strips is not remove from wall in corridor near cold water through (Piau) at ground floor.

ख. वैद पंडित खुशीराम सर्वोदय बाल विद्यालय, नांगल ठाकरान

- 1- Ceiling junction boxes are not closed at many places.
20. Electric wire joints not taped properly at some places on ceiling. **(ACTION: EE, Elect.)**
21. Floor and wall tiles are broken at some places i.e. toilet, stair wall and outside wall of the classroom at first floor corridor.

ग. उपदेश कौर सर्वोदय कन्या विद्यालय, दरियापुर कलां

- 1 Painting work in classrooms was found satisfactory.
- 2 Repair of Sun Shade, parapet wall has not been done properly in Administrative Block.
- 3 Primary wing was also inspected where some repair was in progress and no painting work was carried out in this wing.

घ. Inspection of Road from Badli to Bawana Road

During inspection of this road, following deficiencies have been observed.

1. Lane marking is missing at many places . The same has to be done immediately.
2. Painting of kerb stone have not yet been started.
3. Pot hole and road cut was observed at central carriageway at Mahadev Chowk. Same may be repaired immediately.
4. Central verge is damaged at many places specially from Mahavir Chowk & towards Bawana.
5. Plantation on central verge has to be done at many places. **(Action: DDH)**
6. Pruning of shrub and trees at central verge is required at many places. **(Action: DDH)**
7. Some patch work is to be done near Anand Vihar Colony.
8. Cleaning of sides of road and kerb channel along drain near poth khurd is required.
9. Kerb stone from central verge and foot-path are dislocation from its position. The same may be refixed immediately and at many places kerb stone are missing.
10. Lane marking on C.C. road is missing.
11. Man hole cover at one place was missing on Bawana to Kanjhawala Road.
12. Grass is growing along drain in kerb channel.
13. Encroachment on foot-path drain near Prahalad Pur was observed. Action may be taken to remove the same.
14. Cleaning of kerb channel from bell mouth No.365 to 366 is required.
15. Local depression in foot-path/ sides of road near bell mouth No.366 was observed. The same may be rectified immediately.
16. Cleaning of kerb channel from bell mouth No.107 to 320 is required.
17. Foot-path was found damaged near bell mouth No. 246 to 290.

18. One main hole cover was found depressed near bell mouth No.210 which may be raised to road level
19. Many bell mouths were found closed specially bell mouth No.83 and nearby.

दिनांक: 10-08-2017

1 MALIK RAM TANDON MARG

Many pot holes were observed on this road. The same may be repaired immediately.

2. **ARIHANT MARG**

1. Strengthening of this road has recently been done but some portion of service road and main road is still to be done near F.O.B.
2. Lot of grass is growing on foot-path along service ;road which was also observed during my previous inspection but no action has been taken by field staff to remove the same. This is very serious matter and needs immediate cutting / uprooting of grass from foot-path and cleaning of kerb channel without any further delay.
3. Some surplus earth from central verge is to be removed from many places. Gap filling by plantation on central verge is to be done at many places. **(ACTION: DD(H))**

विद्यालयों एवं रोड के निरीक्षण के दौरान पाई गई कमवार त्रुटियों का निवारण शीघ्रातिशीघ्र करें तथा इन त्रुटियों के अतिरिक्त अगर कहीं ओर भी कोई इस प्रकार की कमी कार्य में पाई जाती है तो उसे भी शीघ्र ठीक कर अनुपालन रिपोर्ट इस कार्यालय को भेजें ।

(मोहन लाल)

अधीक्षण अभियंता (उत्तर)

प्रतिलिपि:-

1. मुख्य अभियंता, उत्तरी अनुरक्षण अंचल, लो.नि.वि., एम.एस.ओ. भवन, नई दिल्ली को सप्ताहिक रिपोर्ट भेजने के संबंध में सूचनार्थ ।

21/8
अधीक्षण अभियंता (उत्तर)