

ACCIDENT PRONE ZONE – 2017

S.NO	S.No. as per list	ACCIDENT_PRONE_ZONE	Office	STATUS OF ACTION TAKEN	Remarks
1	21	ROUND ABOUT BHAIRON ENCLAVE	South East Circle	Matter pertain to South East Circle.	As per report given by South
2	33	ASHRAM CHOWK	South East Circle	ashram chowk is handed over to DMRC	
3	36	HOTEL CROWN PLAZA MAA ANAND MAI MARG	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
4	41	SARITA VIHAR FLYOVER	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately	
5	43	DND FLYOVER	South East Circle	Pertain to DND Express authority.	
6	51	KALINDI KUNJ	South East Circle	Pot hole filled up, estimate for widening of road is in progress, footpath also improved.	
7	57	ICD TUGLAKABAD	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately	
8	61	JAITPUR MORE	South East Circle	Pot hole filled up, estimate for widening of road is in progress, footpath also improved.	
9	66	LAJPAT NAGAR FLYOVER	South East Circle	All expansion joints are in order now	
10	67	AIIMS	South East Circle	Re-surfacing of AIIMS flyover already completed	
11	88	GOVINDPURI METRO STATION	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
12	98	SARITA VIHAR METRO STATION	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
13	105	PRAGATI MAIDAN GATE NO. 5	South East Circle	Pertain to C & ND	
14	106	APOLO HOSPITAL	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
15	111	TOLL PLAZA BADARPUR	South East Circle	Pertain to NHAI	
16	117	MOOL CHAND	South East Circle	Jersey barriers has been placed as per Traffic Police directions	
17	119	SURAJ KUND CROSSING MB ROAD	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
18	133	ROUND ABOUT OKHLA ESTATE	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
19	135	OKHLA MORE	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	

Accident Prone Zone-2018

SL. NO.	SL. NO. As per List	Accident Prone Zone	Office	Status of Action Taken	Remarks
1	16	Indira Kalyan Vihar Red Light	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately	
2	30	SARITA VIHAR FLYOVER	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately	
3	33	Jasola Vihar	South East Circle	Area pertains to South East Circle.	As per report given by South Circle
4	34	Mool Chand	South East Circle	Area pertains to South East Circle.	
5	57	Modi Mill Flyover	South East Circle	Area pertains to South East Circle.	
6	60	TOLL PLAZA BADARPUR	South East Circle	Pertain to NHAI	
7	64	OKHLA MORE	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
8	67	ASHRAM CHOWK	South East Circle	ashram chowk is handed over to DMRC	
9	72	ESI Hospital, Anand Mai Marg	South East Circle	Road condition improved, work of providing railing on central verge is in progress , pot hole repaired	
10	75	Tara Apartment	South East Circle	Road condition improved, pot hole repaired, work of table top will be taken up	
11	84	Agra Canal Road Jaitpur	South East Circle	Pertain to UP Irrigation Department	
12	87	Lohia Pull	South East Circle	Pertain to UP Irrigation Department	
13	90	DND FLYOVER	South East Circle	Pertain to DND Express authority.	
14	96	AIIMS	South East Circle	Area pertains to South East Circle.	As per report given by South Circle
15	99	Kalindi Kunj	South East Circle	Road condition improved, U turn also improved,	
16	104	ROUND ABOUT OKHLA ESTATE	South East Circle	Road condition improved, pot hole whenever noticed filled up immediately.	
17	105	Kalkaji Mandir	South East Circle	Road condition improved, FOB is maintained properly to provide better access to pedestrian,	
18	109	Nehru Place	South East Circle	Road condition improved, FOB is maintained properly to provide better access to pedestrian,	
19	110	Okhla Mandi	South East Circle	Road condition improved, FOB is maintained properly to provide better access to pedestrian,	