

	<p align="center">CHIEF PROJECT MANAGER (FLYOVER) 1 PUBLIC WORKS DEPARTMENT GOVT. OF DELHI MUKARBA CHOWK, G. T. KARNAL ROAD, DELHI – 110033</p> <p align="center">Ph: 011-27691871, Fax No.: 011-27691971 E-Mail: cpmpwddelhif1@gmail.com</p>	 एक कदम स्वच्छता की ओर
---	--	--

F. No. 23(29-I)/CPM/F 1/PWD/2015/

2928

Date: - 31-12-15

Sub: - Inspection Note for the work of “Comprehensive Development of Corridor (Outer Ring Road) between Vikaspuri to Meera Bagh.”

Inspected the site of Vikaspuri to Meerabagh Project on 30.12.2015 along with the Superintending Engineer, F-12 and the DPM of M/s. Simplex. The Project Manager of M/s. Simplex was not present during the inspection due to his pre-engagement at his headquarter.

Laying of paver blocks in service road on R.H.S., adjacent to A-2 ramp has been started as at this location, due to existing services, bituminous road cannot be constructed. It was directed to ensure proper compaction of bedding sand. While laying the paver blocks, the level of the paver blocks should be ensured so as to have the footpath height as per UTTIPEC guidelines.

Then went to the pier P-62_63 where underdeck finishing has been started at one location. It is felt that this is a time consuming activity and more number of gangs should be deployed at different locations to do the desired underdeck finishing. It is reiterated that the underdeck finishing involves the following activities: -

- Removal of cement slurry at the lateral stitch portion, then, grinding of the joints,
- Underdeck finishing of spine segments including forming of grooves at the junction of two spine segments filled during grouting.
- Any other repair in the concrete surface by grinding so as to have a smoother surface before painting with anti-carbonation paint.
- Repair around stubs of spine segments where wing segments have been rested using proper reinforcement and thereafter grinding the repaired surface to have a smoother surface.

Then, went to the nallah portion where erection of portal beam has not been started despite earlier commitment by the agency. Even the approach slab of A-1 side of service road on L.H.S. has not been casted though it was to be casted last week. The SE, F-12, PWD informed that the agency is not making payments to the various venders due to which these venders are not supplying the material/executing the various works. The matter was discussed with Mr. P. Sen Gupta, Vice-President to immediately intervene and make the payments to various venders so that the work is not further delayed. The SE, F-12 was also directed to call a meeting with Mr. Mundra, M.D. of M/s. Simplex on top priority.

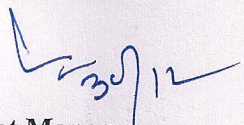
Then, went to the A-1 ramp where friction slab casting has been started.

In the site office, reviewed the program of various activities, prepared by the agency. As per the program prepared, the elevated corridor, except nallah portion is going to be completed by 28th Feb.' 2015 which is not acceptable. It is felt that by deploying more resources at different locations, elevated corridor, except nallah portion, can be completed by 31st Jan.' 2016. The various pending activities as on date are lateral stitch, casting of concrete in deck continuity portion, filling the gaps in crash

barrier/central verge at deck continuity portion, filling of lifting holes, over deck cleaning for laying the APP layer, DBM/BC, expansion joints, painting of crash barrier after erection of surface, khurra around the rain water pipe etc. These are such activities which can be taken up at different locations simultaneously. More gangs are required to be deployed for expediting the same. The SE, F-12 was directed to prepare a program so as to complete these activities by 31st Jan.' 2016 and also to work out the resources required for the same.

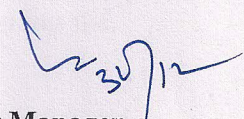
The matter was also discussed with the MD of M/s. P&R for expediting the erection work in nallah portion. He also complained about non-payment by M/s. Simplex. He was requested to expedite the erection process on priority.

The other activities of drain, footpath, construction of table tops should also be expedited.


de Chief Project Manager
(Flyover) 1, PWD

Copy to:-

- (1) The E-in-Chief (Projects), (Flyover) 1, PWD, 12th Floor, MSO Building, I.P. Estate, New Delhi for kind information please.
- (2) The Pr. Chief Engineer (Projects), PWD, 9th Floor, MSO Building, I.P. Estate, New Delhi for kind information please.
- (3) The OSD (PWD) to Minister, O/o of the Minister, Power, PWD, Health, Industries & Home, GNCTD, A-Wing, 7th Level, Delhi Secretariat, I.P. Extension, New Delhi-110002 for kind information please.
- (4) The Superintending Engineer, F-12, PWD for information & necessary action please.


de Chief Project Manager