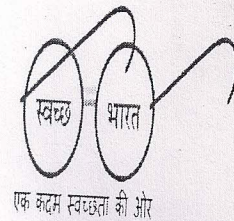


CHIEF PROJECT MANAGER
(FLYOVER) 1
PUBLIC WORKS DEPARTMENT
GOVT. OF DELHI
MUKARBA CHOWK, G. T. KARNAL ROAD,
DELHI - 110033

Ph: 011-27691871, Fax No.: 011-27691971
E-Mail: cpmpwddelhi1@gmail.com



एक कदम स्वच्छता की ओर

F. No. 23(28-I)/CPM/F 1/PWD/2016/ 1969

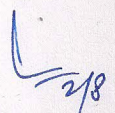
Inspection Note

Date: - 2-8-16

Sub: -Inspection Note for the work of "Comprehensive Development of Corridor (Outer Ring Road) between Madhuban Chowk to Mukarba Chowk."

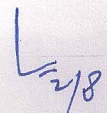
Inspected the site of Madhuban Chowk to Mukarba Chowk along with the AE of F-14 and Project Manager of M/s. ITD Cementation on 02.08.2016. The SE, F-14 was not present. Following are the observations: -

- ✓ While doing anti-carbonation paint, proper finish of the concrete surface should be ensured. It should also be ensured that the work is carried out as per specifications and theoretical consumption of the paint should also be maintained.
- ✓ At number of locations, the doors of the bends of rain water pipe have not been fixed leading to dropping of water from the elevated corridor which is damaging the road also. The same should be fixed on priority.
- ✓ The site should be cleaned of malba from one end to another on priority.
- ✓ The rain water pipe should be connected to rain water harvesting chamber and overflow pipe at appropriate level should be provided.
- ✓ The work of signage should also be expedited which has been delayed badly.
- ✓ The rectification of footpath work has not been completed including levelling of manhole's cover with adjacent tiles. The same should be expedited.
- ✓ At number of places, the road work in service road is still pending which should be completed on priority.
- ✓ At one location, it was found that additional bell mouth pipe is required to drain out the water which is accumulated along the kerb line near A-1 pier. The whole project stretch should be inspected with respect to this and wherever additional bell mouth pipes are required, may be given.
- ✓ During rainy season, the site should be inspected to ensure that there is not accumulation of water at any location.
- ✓ The malba filled in the central verge should also be removed so that horticulture agencies start its work on priority.


Chief Project Manager
(Flyover) 1, PWD

Copy to:-

- (1) The E-in-Chief, PWD, 12th Floor, MSO Building, I.P. Estate, New Delhi for kind information please.
- (2) The Pr. Chief Engineer (Projects), PWD, 9th Floor, MSO Building, I.P. Estate, New Delhi for kind information please.
- (3) The OSD (PWD) to Minister, O/o of the Minister, Power, PWD, Health, Industries & Home, GNCTD, A-Wing, 7th Level, Delhi Secretariat, I.P. Extension, New Delhi-110002 for kind information please.
- (4) The Superintending Engineer, F-14, PWD for information & necessary action please.


Chief Project Manager